TERMITE REINSPECTION REPORT

Street address	City	State / ZIP	Date of reinspection	Pages
5604 Gloster Road	Bethesda	MD 20816	10/20/2026	2

PT

Patuxent Termite & Pest Control, Inc.
7920 Cessna Avenue, Suite 104
Gaithersburg, MD 20879
(301) 555-0142
office@patuxenttermite.com

Report No. 26-1047
MDA license No. 34127
County Montgomery

Inspection performed for	Mailing address
Thomas and Helen Albrecht	5604 Gloster Road, Bethesda, MD 20816

First inspection and coverage

First inspection and diagram	Original treatment	Warranty or service agreement	Covered through
06/12/2023	06/20/2023, Termidor SC	Yearly retreatment warranty	06/19/2027

Findings

☐ No visible evidence ☑ Visible evidence found

Wood destroying insects or visible evidence, and where
Live subterranean termites in new shelter tubes on the garage's left foundation wall, 6 ft from the front.

Visible damage, and whether it has been or will be corrected
None visible. The garage sill sounded solid when probed. No new activity at the 2023 rear wall area.

Conditions conducive to infestation
Firewood stacked against the garage's left wall, and mulch over the foundation line in the front beds.

Areas not inspected, and why
Garage rear wall behind stored bins and shelving. Finished basement walls and ceiling in the family room.

Inspection diagram

☑ Updated (page 2) ☐ No update needed

Reason for the update
- ☑ Structural changes visible
- ☑ Insect reinfestation observed

What changed on the diagram
Added the 2025 deck (mark 4), the new garage tubes (mark 2), and the firewood (mark 3).

Treatment

☐ None needed ☑ Treated this visit

Pesticide (common name or active ingredient)	EPA Reg. No.	Area treated	Amount used
Termidor SC Fipronil 9.1%	7969-210	Garage, left wall: 12 linear ft trenched and rodded, slab drilled along the wall	6 gal at 0.06%

Inspected by	MDA certificate or ID card No.	Inspector's signature	Date
Kevin Mahoney	34127-62418	*Kevin Mahoney*	10/20/2026

COMAR 15.05.01.14A(2) and (4): "The inspector shall report accurately all findings in writing to the person or persons for whom the inspection was performed." "A copy of any inspection report for pest control contracted shall be held by each licensee, permit or certificate holder for 2 years, and shall be made available, upon request, to the Department."

Updated Inspection Diagram

Page 2 of the Termite Reinspection Report

Company Patuxent Termite & Pest Control, Inc. Date of reinspection 10/20/2026

Property address 5604 Gloster Road, Bethesda, MD 20816

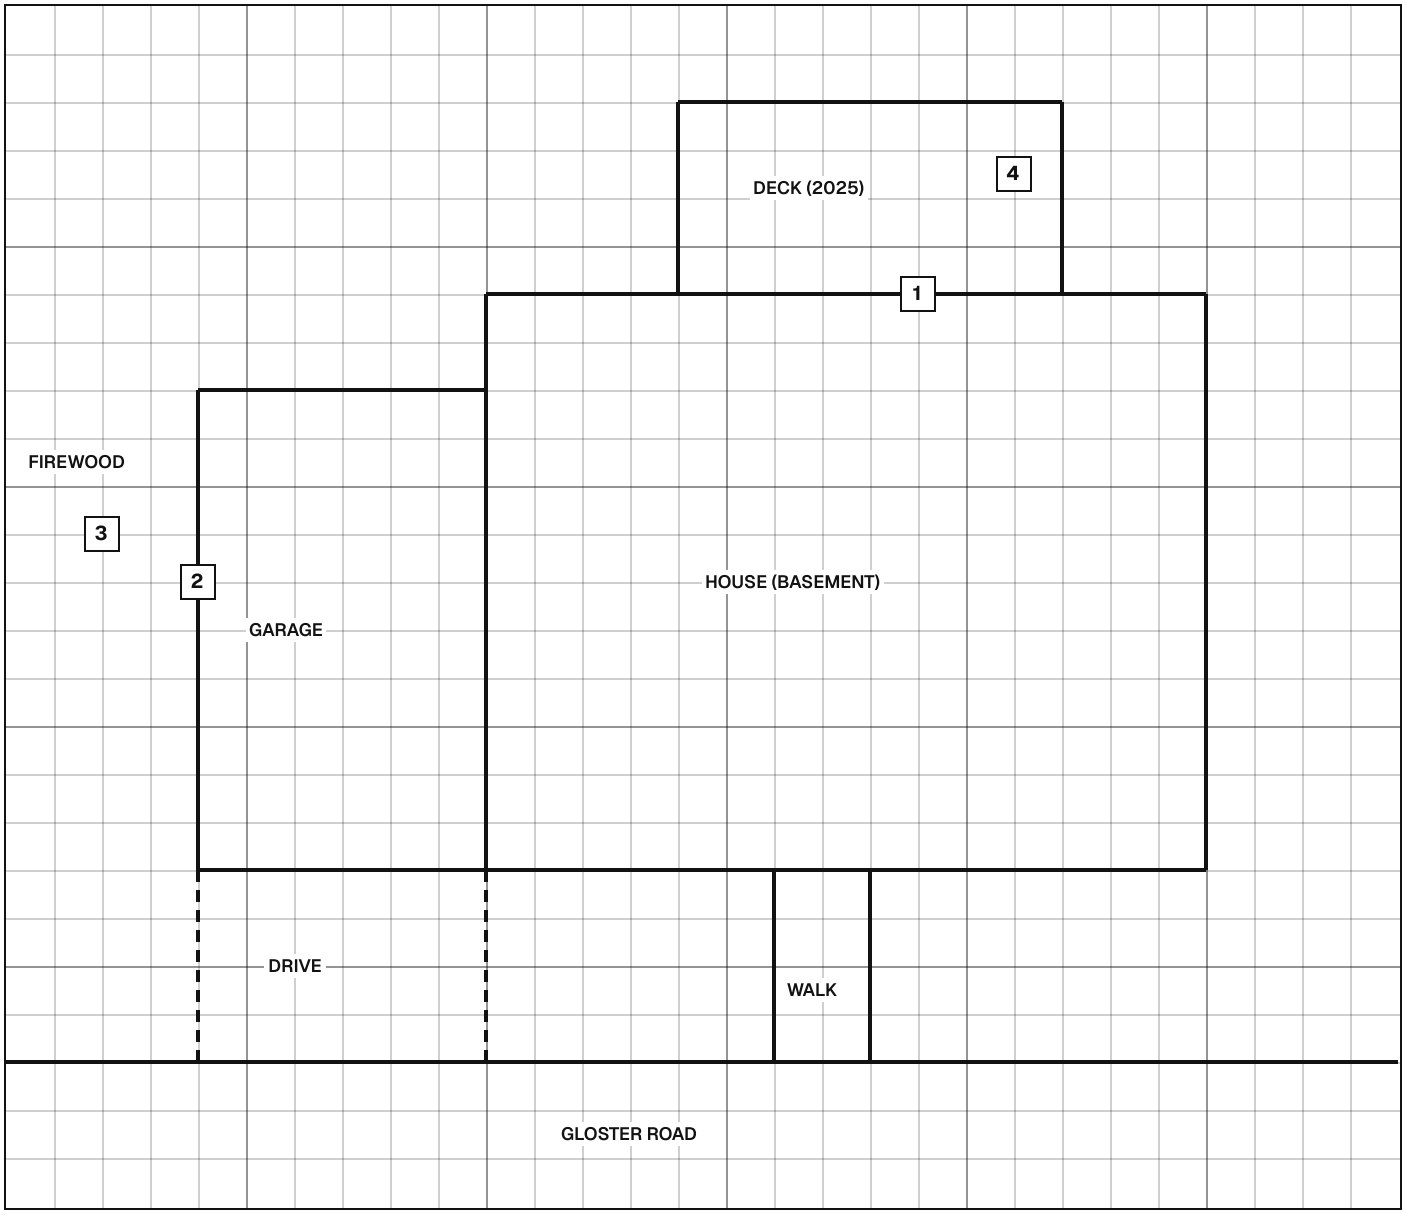

Key

1	2023: live termites at the rear basement wall, treated 06/20/2023. No new activity found
2	New 10/20/2026: live shelter tubes on the garage's left foundation wall, up to the sill plate. Treated
3	New 10/20/2026: firewood stacked against the garage's left wall (conducive condition)
4	New 10/20/2026: deck added in 2025. Inspected from below, no evidence found
5	
6	

COMAR 15.05.01.14A(3): "Upon subsequent inspection, the initial inspection diagram shall be updated if structural changes are visible or when an insect reinfestation is observed."